

This area is causing considerable problems with damp and water ingress. When access is possible these issues must be resolved before any work starts on renovation

When access is possible, lead work around chimney to be checked and replaced if necessary. Chimney pots to be checked and repaired/replaced. Chimney to be raked and repointed with lime mortar

This area is causing considerable problems with damp and water ingress. When access is possible these issues must be resolved before any work starts on renovation

When access is possible, lead work around chimney to be checked and replaced if necessary. Chimney pots to be checked and repaired/replaced. Chimney to be raked and repointed with lime mortar

Slate roof appears to be in good condition, further inspection required when access is possible

When access is possible, ridge tiles to be checked, if necessary ridge tiles to be rebedded

Slate roof appears to be in good condition, further inspection required when access is possible

further investigation required. If necessary leadwork to be replaced

lead gutter to be stripped and lead replaced with shorter lengths, stepped

this valley is leaking: lead to be lifted and timber under inspected and replaced as necessary

When access is possible, lead work around chimney to be checked and replaced if necessary. Chimney pots to be checked and repaired/replaced. Chimney to be raked and repointed with lime mortar

Slate roof appears to be in good condition, further inspection required when access is possible

When access is possible, ridge tiles to be checked, if necessary ridge tiles to be rebedded

When access is possible, lead work to roof to be checked

When access is possible, lead work to roof to be checked

When access is possible, lead work to roof to be checked

Slate roof appears to be in good condition, further inspection required when access is possible

SIGNIFICANT DAMP PENETRATION IN THIS AREA. STURCTURAL TIMBERS TO REPLACE ETC

this is already part of contract

When access is possible, lead work around chimney to be checked and replaced if necessary. Chimney pots to be checked and repaired/replaced. Chimney to be raked and repointed with lime mortar

A 150621 Input and extract cowls for MVHR located in Attic Room above new entrance

status  
Contract

project  
HIGHGREEN MANOR

drawing  
UNITS 3 AND 4: ROOF PLAN:  
PROPOSED  
With refurbishment notes

project nr	drawing nr	amendment
574	119	A

scale	date
1:50 @A2	0621

**NEWTON ARCHITECTS**

Chartered architect landscape & energy consultant  
t: 0191 413 3996 e: liam@newtonarchitects.com

© THIS DRAWING IS COPYRIGHT do not scale: report discrepancies: if in doubt, ask

